

Inspection Report

John Doe

Property Address: 37 Star Lane

New York NY



Home Detectives of Long Island, Inc.

Rob DeSanto 16000065890 1250 Wantagh Ave, Box 7828 Wantagh, NY 11793

Table of Contents

Cover Page	<u>1</u>
Table of Contents	2
Intro Page	3
1 Roofing / Chimneys / Roof Structure and Attic	
2 Exterior	6
3 Garage	
4 Kitchen Components and Appliances	
5 Rooms	
6 Bathroom and Components	
7 Structural Components	
8 Plumbing System	
9 Electrical System	
10 Heating / Central Air Conditioning	
11 Home Warranty Offer	
General Summary	
Invoice	
Agreement	

37 Star Lane Page 2 of 36

Date: 3/30/2012	Time:	Report ID: 37 star lane
Property:	Customer:	Real Estate Professional:
37 Star Lane	John Doe	Victor Tate
New York NY		Victor Realty

Comment Key or Definitions

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this home. Any recommendations by the inspector to repair or replace suggests a second opinion or further inspection by a qualified contractor. All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.

<u>Inspected (IN)</u> = I visually observed the item, component or unit and if no other comments were made then it appeared to be functioning as intended allowing for normal wear and tear.

Not Inspected (NI)= I did not inspect this item, component or unit and made no representations of whether or not it was functioning as intended and will state a reason for not inspecting.

Not Present (NP) = This item, component or unit is not in this home or building.

Repair or Replace (RR) = The item, component or unit is not functioning as intended, or needs further inspection by a qualified contractor. Items, components or units that can be repaired to satisfactory condition may not need replacement.

In Attendance: Type of building: Approximate age of building: Customer Single Family (1 story) Under 5 Years Temperature: Weather: Ground/Soil surface condition: Over 65 Cloudy Dry Rain in last 3 days: **Radon Test: Water Test:** Yes Yes, No No

37 Star Lane Page 3 of 36

1. Roofing / Chimneys / Roof Structure and Attic

The home inspector shall observe: Roof covering; Roof drainage systems; Flashings; Skylights, chimneys, and roof penetrations; and Signs of leaks or abnormal condensation on building components. The home inspector shall: Describe the type of roof covering materials; and Report the methods used to observe the roofing. The home inspector is not required to: Walk on the roofing; or Observe attached accessories including but not limited to solar systems, antennae, and lightning arrestors.

Styles & Materials

Method used to observe attic:

Viewed roof covering from: Roof-Type: Roof Covering:

Ground Gable 3-Tab fiberglass

Chimney (exterior): Sky Light(s): Roof Ventilation:

Rock Three Ridge vents

Roof Structure:

Soffit Vents

Ceiling Structure:

Walked Engineered wood trusses 2X6

2 X 12 Rafters
Lateral bracing
Sheathing

Attic info: Attic Insulation:

Pull Down stairs Blown

Cellulose R-30 or better

Items

1.0 Roof Coverings

Comments: Repair or Replace

- (1) Evidence of a leak in the Den below corresponds with the middle skylight roof and flashing area. Repairs are needed. Recommend a qualified contractor inspect further and repair as needed.
- (2) The roof covering was installed improperly above garage. Roof sheathing needs to be replaced in this area. This will involve some shingle replacement. A qualified contractor should inspect and repair as needed.



1.0 Item 1(Picture)

1.1 Flashings

Comments: Inspected

1.2 Skylights, Chimneys and Roof Penetrations

Comments: Inspected

37 Star Lane Page 4 of 36

1.3 Roof Ventilation

Comments: Inspected

1.4 Roof Drainage Systems (gutters and downspouts)

Comments: Repair or Replace

The gutter screens are missing at the front of home above garage. Gutters that drain poorly or clogged can lead to many costly problems such as deterioration of fascia, soffit or roof edge. It can also cause gutters to pull loose and lead to possible water intrusion. A qualified person should repair or replace as needed.

1.5 Roof Structure and Attic (Report leak signs or condensation)

Comments: Inspected

No longer an attic access. Use the pull down stairs at garage.



1.5 Item 1(Picture)

1.6 Ventilation Fans and Thermostatic Controls (Attic)

Comments: Inspected

1.7 Insulation in Attic

Comments: Inspected

1.8 Visible Electric Wiring in Attic

Comments: Inspected

The roof of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Roof coverings and skylights can appear to be leak proof during inspection and weather conditions. Our inspection makes an attempt to find a leak but sometimes cannot. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

37 Star Lane Page 5 of 36

The home inspector shall observe: Wall cladding, flashings, and trim; Entryway doors and a representative number of windows; Garage door operators; Decks, balconies, stoops, steps, areaways, porches and applicable railings; Eaves, soffits, and fascias; and Vegetation, grading, drainage, driveways, patios, walkways, and retaining walls with respect to their effect on the condition of the building. The home inspector shall: Describe wall cladding materials; Operate all entryway doors and a representative number of windows; Operate garage doors manually or by using permanently installed controls for any garage door operator; Report whether or not any garage door operator will automatically reverse or stop when meeting reasonable resistance during closing; and Probe exterior wood components where deterioration is suspected. The home inspector is not required to observe: Storm windows, storm doors, screening, shutters, awnings, and similar seasonal accessories; Fences; Presence of safety glazing in doors and windows; Garage door operator remote control transmitters; Geological conditions; Soil conditions; Recreational facilities (including spas, saunas, steam baths, swimming pools, tennis courts, playground equipment, and other exercise, entertainment, or athletic facilities); Detached buildings or structures; or Presence or condition of buried fuel storage tanks. The home inspector is not required to: Move personal items, panels, furniture, equipment, plant life, soil, snow, ice or debris that obstructs access or visibility.



Styles & Materials

Siding Style:

RB&B (Reverse board and batten)

Brick

Appurtenance:

Covered porch

Porch

Sidewalk

Patio

Items

Siding Material:

Wood

Full brick

Driveway:

Asphalt

Exterior Entry Doors:

Steel

Insulated glass


2.0 Wall Cladding, Flashing and Trim

Comments: Repair or Replace

The Wood siding at the right side (facing front) and rear of home is missing or incomplete at time of inspection around new premium windows that have recently been installed. I did not inspect the installation of siding at this location. A qualified contractor should inspect and repair as needed. The siding will need prep and paint.

37 Star Lane Page 6 of 36



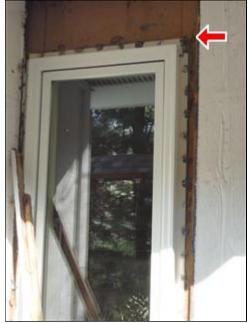

2.0 Item 1(Picture)

2.0 Item 2(Picture)





2.0 Item 3(Picture)

2.0 Item 4(Picture)

2.1 Doors (Exterior)

Comments: Inspected

2.2 Windows

Comments: Inspected

2.3 Decks, Balconies, Stoops, Steps, Areaways, Porches, Patio/Cover and Applicable Railings Comments: Inspected


2.4 Vegetation, Grading, Drainage, Driveways, Patio Floor, Walkways and Retaining Walls (With respect to their effect on the condition of the building)

Comments: Repair or Replace

(1) Possible water run-off from the street into driveway during rain. I am unable to determine the frequency or amount.

(2) The brick walkway at the front of home are deteriorated in areas. A general replacement is likely. A qualified contractor should inspect and repair as needed.

37 Star Lane Page 7 of 36

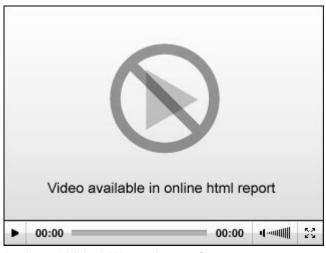

Loose trip hazard

2.4 Item 1(Video) Water signs at front step

2.4 Item 2(Picture)





2.4 Item 3(Picture)

2.4 Item 4(Picture)

(3) Concrete is cracked at front entrance of home. Appears to only affect the slab itself and is more cosmetic.



2.4 Item 5(Picture)

(4) The brick floor on the patio at the left side (facing front) has deteriorated mortar or grout, and is loose and uneven in areas. Water can cause further deterioration if not repaired and sealed properly. A qualified contractor should inspect and repair as needed.

37 Star Lane Page 8 of 36



2.4 Item 6(Picture)

(5) The brick floor on the patio at the rear of home is old and deteriorated. A general replacement is likely. A qualified contractor should inspect and repair as needed.



2.4 Item 7(Picture)

2.5 Eaves, Soffits and Fascias

Comments: Repair or Replace

(1) The wood fascia and soffit panels at eave on the front of home above garage are deteriorated. Repairs are needed to roof covering as well. A qualified contractor should inspect and repair as needed.

37 Star Lane Page 9 of 36





2.5 Item 1(Picture)

2.5 Item 2(Picture)

(2) The wood fascia at eave on the right side (facing front) is deteriorated. This is a small repair. A qualified contractor should inspect and repair as needed.



2.5 Item 3(Picture)

2.6 Plumbing Water Faucets (hose bibs)

Comments: Inspected

2.7 Outlets (Exterior)

Comments: Inspected

2.8 Other

Comments: Inspected

Possible bees nest forming at right corner of front steps (see video)

The exterior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

37 Star Lane Page 10 of 36

3. Garage

Styles & Materials

Garage Door Type:
One automatic

Garage Door Material:

Insulated

Metal

Items

3.0 Garage Ceiling

Comments: Inspected

3.1 Garage Walls (Including Firewall Separation)

Comments: Inspected

3.2 Garage Floor

Comments: Inspected

3.3 Garage Door (s)

Comments: Inspected

3.4 Occupant Door from Garage to inside home

Comments: Inspected

3.5 Garage Door Operators (Report whether or not doors will reverse when met with resistance)

Comments: Inspected

The garage door will reverse when met with resistance.

37 Star Lane Page 11 of 36

4. Kitchen Components and Appliances

The home inspector shall observe and operate the basic functions of the following kitchen appliances: Permanently installed dishwasher, through its normal cycle; Range, cook top, and permanently installed oven; Trash compactor; Garbage disposal; Ventilation equipment or range hood; and Permanently installed microwave oven. The home inspector is not required to observe: Clocks, timers, self-cleaning oven function, or thermostats for calibration or automatic operation; Non built-in appliances; or Refrigeration units. The home inspector is not required to operate: Appliances in use; or Any appliance that is shut down or otherwise inoperable.

Styles & Materials

Dishwasher Brand: Disposer Brand: Exhaust/Range hood:

KENMORE IN SINK ERATOR **RE-CIRCULATE**

Range/Oven: **Built in Microwave:** Cabinetry: **KENMORE** GENERAL ELECTRIC Wood

Dryer Power Source: Clothes Dryer Vent Material: Countertop: 220 Electric

Granite **PVC** Rigid

Items

4.0 Ceiling

Comments: Inspected

4.1 Walls

Comments: Inspected

4.2 Floor

Comments: Inspected 4.3 Pantry/Closet Doors Comments: Inspected

4.4 Windows

Comments: Inspected

4.5 Counters and a representative number of Cabinets

Comments: Repair or Replace

Base Cabinetry and trim at wall cabinet are unfinished at kitchen.





4.5 Item 2(Picture)

4.5 Item 1(Picture)

4.6 Plumbing Drain and Vent Systems

Comments: Inspected

4.7 Plumbing Water Supply Faucets and Fixtures

Comments: Inspected

37 Star Lane Page 12 of 36

4.8 Outlets Wall Switches and Fixtures

Comments: Inspected

4.9 Dishwasher

Comments: Repair or Replace

The dishwasher is loose and needs securing to underside of countertop (using a proper length screw). I recommend repair as necessary.

4.10 Ranges/Ovens/Cooktops

Comments: Inspected

4.11 Range Hood

Comments: Inspected

4.12 Trash Compactor

Comments: Not Present


4.13 Food Waste Disposer

Comments: Inspected

4.14 Microwave Cooking Equipment

Comments: Repair or Replace

The microwave door handle is broken. I recommend repair as needed.

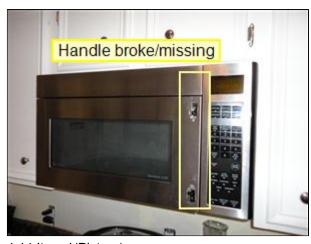

4.14 Item 1(Picture)

4.15 Clothes Dryer Vent Piping

Comments: Inspected

The built-in appliances of the home were inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

37 Star Lane Page 13 of 36

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.

Styles & Materials

Ceiling Materials: Wall Material: Floor Covering(s):

Drywall Drywall Carpet

Suspended ceiling panels Hardwood T&G

Tile

Interior Doors: Window Types: Window Manufacturer:

Raised panel Casement UNKNOWN
Wood Double-hung

Thermal/Insulated

Tilt feature

Items

5.0 Ceilings

Comments: Repair or Replace

(1) The Sheetrock on the ceiling reveals a water stain indicating a leak did or still exists at the Den. Repairs are needed. A qualified contractor should inspect and repair as needed (See Roof Coverings).



5.0 Item 1(Picture)

(2) Water stain on ceiling panel lower level indicates plumbing leak.

37 Star Lane Page 14 of 36



5.0 Item 2(Picture)

(3) The Drywall on the ceiling reveals a water stain indicating a leak did or still exists at the Dining Room. Repairs are needed. A qualified contractor should inspect and repair as needed.





5.0 Item 3(Picture)

5.0 Item 4(Video)

5.1 Walls

Comments: Repair or Replace

- (1) Unfinished around windows in kitchen, and Den.
- (2) The Wall at the bathtub is deteriorated and needs repair or replacement. The wall board and framing may need repair (not visible). I recommend repair or replace using a qualified contractor.

37 Star Lane Page 15 of 36



5.1 Item 1(Picture)

(3) The sheetrock on the wall is dented or damaged from door knob at the hallway. While this damage is cosmetic, it needs to be repaired. A qualified contractor should inspect and repair as needed.



5.1 Item 2(Picture)

(4) Stair cover trim is unfinished needs prep and paint at stairs.



5.1 Item 3(Picture)

5.2 Floors

Comments: Repair or Replace

37 Star Lane Page 16 of 36

Carpet is loose or cut short from where electric baseboard use to be in areas around the perimeter of the Den.



5.2 Item 1(Picture)

5.3 Steps, Stairways, Balconies and Railings

Comments: Inspected

Stair side trim have been prepped some but unfinished.

5.4 Doors (Representative number)

Comments: Inspected

5.5 Windows (Representative number)

Comments: Inspected

5.6 Outlets, Switches and Fixtures

Comments: Inspected

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

37 Star Lane Page 17 of 36

6. Bathroom and Components

Styles & Materials

Exhaust Fans:

Fan/Heat/Light

Items

6.0 Counters and Cabinets

Comments: Inspected

6.1 Doors (Representative number)

Comments: Inspected

6.2 Windows

Comments: Inspected

6.3 Plumbing Drain, Waste and Vent Systems

Comments: Inspected

6.4 Plumbing Water Supply and Distribution Systems and Fixtures

Comments: Inspected

6.5 Outlets Switches and Fixtures

Comments: Inspected

6.6 Exhaust fan

Comments: Inspected

37 Star Lane Page 18 of 36

7. Structural Components

The Home Inspector shall observe structural components including foundations, floors, walls, columns or piers, ceilings and roof. The home inspector shall describe the type of Foundation, floor structure, wall structure, columns or piers, ceiling structure, roof structure. The home inspector shall: Probe structural components where deterioration is suspected; Enter under floor crawl spaces, basements, and attic spaces except when access is obstructed, when entry could damage the property, or when dangerous or adverse situations are suspected; Report the methods used to observe under floor crawl spaces and attics; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to: Enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely effect the health of the home inspector or other persons.

Styles & Materials

Foundation: Method used to observe Crawlspace: Floor Structure:

Masonry block Limited access 2 X 8

Wood joists

Slab

Engineered floor trusses

Wall Structure: Columns or Piers: Floor System Insulation:

Masonry Steel lally columns Unfaced 2 X 4 Wood Supporting walls Batts

Fiberglass R-19

Items

7.0 Foundations, Basements and Crawlspaces (Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components.)

Comments: Inspected

7.1 Walls (Structural)

Comments: Inspected

7.2 Columns or Piers

Comments: Inspected

7.3 Floors (Structural)

Comments: Inspected

7.4 Ceilings (Structural)

Comments: Inspected

7.5 Insulation under Floor System

Comments: Inspected

7.6 Vapor Retarders (On ground in crawlspace or basement)

Comments: Inspected

7.7 Ventilation of Foundation Area (crawlspace or basement)

Comments: Inspected

The structure of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

37 Star Lane Page 19 of 36

8. Plumbing System

The home inspector shall observe: Interior water supply and distribution system, including: piping materials, supports, and insulation; fixtures and faucets; functional flow; leaks; and cross connections; Interior drain, waste, and vent system, including: traps; drain, waste, and vent piping; piping supports and pipe insulation; leaks; and functional drainage; Hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues, and vents; Fuel storage and distribution systems including: interior fuel storage equipment, supply piping, venting, and supports; leaks; and Sump pumps. The home inspector shall describe: Water supply and distribution piping materials; Drain, waste, and vent piping materials; Water heating equipment; and Location of main water supply shutoff device. The home inspector shall operate all plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance. The home inspector is not required to: State the effectiveness of anti-siphon devices; Determine whether water supply and waste disposal systems are public or private; Operate automatic safety controls; Operate any valve except water closet flush valves, fixture faucets, and hose faucets; Observe: Water conditioning systems; Fire and lawn sprinkler systems; On-site water supply quantity and quality; On-site waste disposal systems; Foundation irrigation systems; Spas, except as to functional flow and functional drainage; Swimming pools; Solar water heating equipment; or Observe the system for proper sizing, design, or use of proper materials.

Styles & Materials

Water Source: Water Filters: Plumbing Water Supply (into home):

Public None Copper

Plumbing Water Distribution (inside home): Washer Drain Size: Plumbing Waste Line:

Copper 2" Diameter PVC

Water Heater Power Source: Water Heater Capacity: Water Heater Manufacturer:

Electric 50 Gallon (2-3 people) A.O. SMITH

Water Heater Location:

Under Stairs

Items

8.0 Plumbing Drain, Waste and Vent Systems

Comments: Inspected

8.1 Plumbing Water Supply and Distribution Systems and Fixtures

Comments: Inspected

8.2 Hot Water Systems, Controls, Chimneys, Flues and Vents

Comments: Inspected

8.3 Main Water Shut-off Device (Describe location)

Comments: Inspected

The main shut off is the blue knob located at the lower level right when exiting to outside behind small door on wall. This is for your information.

8.4 Fuels Storage and Distribution Systems (Interior fuel storage, piping, venting, supports, leaks)

Comments: Not Present

8.5 Main Fuel Shut-off (Describe Location)

Comments: Not Present

8.6 Sump Pump

Comments: Inspected

The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Washing machine drain line for example cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but then fails under heavy use. If the water is turned off or not used for periods of time (like a vacant home waiting for closing) rust or deposits within the pipes can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

37 Star Lane Page 20 of 36

9. Electrical System

The home inspector shall observe: Service entrance conductors; Service equipment, grounding equipment, main over current device, and main and distribution panels; Amperage and voltage ratings of the service; Branch circuit conductors, their over current devices, and the compatibility of their ampacities and voltages; The operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls; The polarity and grounding of all receptacles within six feet of interior plumbing fixtures, and all receptacles in the garage or carport, and on the exterior of inspected structures; The operation of ground fault circuit interrupters; and Smoke detectors. The home inspector shall describe: Service amperage and voltage; Service entry conductor materials; Service type as being overhead or underground; and Location of main and distribution panels. The home inspector shall report any observed aluminum branch circuit wiring. The home inspector shall report on presence or absence of smoke detectors, and operate their test function, if accessible, except when detectors are part of a central system. The home inspector is not required to: Insert any tool, probe, or testing device inside the panels; Test or operate any over current device except ground fault circuit interrupters; Dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels; or Observe: Low voltage systems; Security system devices, heat detectors, or carbon monoxide detectors; Telephone, security, cable TV, intercoms, or other ancillary wiring that is not a part of the primary electrical distribution system; or Built-in vacuum equipment.

Styles & Materials

Electrical Service Conductors: Panel capacity: Panel Type:

Overhead service 200 AMP Circuit breakers

220 volts

Electric Panel Manufacturer: Branch wire 15 and 20 AMP: Wiring Methods:

GENERAL ELECTRIC Copper Romex

Items

9.0 Service Entrance Conductors

Comments: Inspected

9.1 Service and Grounding Equipment, Main Overcurrent Device, Main and Distribution Panels

Comments: Inspected

9.2 Branch Circuit Conductors, Overcurrent Devices and Compatability of their Amperage and Voltage

Comments: Inspected

9.3 Connected Devices and Fixtures (A representative number of ceiling fans, lighting fixtures, switches, and receptacles inside the house, garage, and on the exterior walls)

Comments: Inspected

9.4 Polarity and Grounding of Receptacles within 6 feet of interior plumbing fixtures, and all receptacles in garage and exterior walls of inspected structure

Comments: Inspected

9.5 Operation of GFCI (Ground Fault Circuit Interrupters)

Comments: Inspected

9.6 Location of Main and Distribution Panels

Comments: Inspected

9.7 Smoke Detectors

Comments: Inspected

9.8 Carbon Monoxide Detectors

Comments: Inspected

The electrical system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Outlets were not removed and the inspection was only visual. Any outlet not accessible (behind the refrigerator for example) was not inspected or accessible. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

37 Star Lane Page 21 of 36

10. Heating / Central Air Conditioning

The home inspector shall observe permanently installed heating and cooling systems including: Heating equipment; Cooling Equipment that is central to home; Normal operating controls; Automatic safety controls; Chimneys, flues, and vents, where readily visible; Solid fuel heating devices; Heat distribution systems including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units, convectors; and the presence of an installed heat source in each room. The home inspector shall describe: Energy source; and Heating equipment and distribution type. The home inspector shall operate the systems using normal operating controls. The home inspector shall open readily openable access panels provided by the manufacturer or installer for routine homeowner maintenance. The home inspector is not required to: Operate heating systems when weather conditions or other circumstances may cause equipment damage; Operate automatic safety controls; Ignite or extinguish solid fuel fires; or Observe: The interior of flues; Fireplace insert flue connections; Humidifiers; Electronic air filters; or The uniformity or adequacy of heat supply to the various rooms.

Styles & Materials

Heat Type: Energy Source: Number of Heat Systems (excluding wood):

Heat Pump Forced Air (also provides cool air) Electric Two

Heat System Brand: Ductwork: Filter Type:

BRYANT Insulated Washable

Types of Fireplaces: Operable Fireplaces: Number of Woodstoves:

Conventional One None

Cooling Equipment Type: Cooling Equipment Energy Source: Central Air Manufacturer:

Heat Pump Forced Air (also provides warm air) Electricity BRYANT

Items

10.0 Heating Equipment

Comments: Inspected

10.1 Normal Operating Controls

Comments: Inspected

10.2 Automatic Safety Controls


Comments: Inspected

10.3 Distribution Systems (including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units and convectors)

Comments: Repair or Replace

The washable filter is dirty. The filter needs to be cleaned. Recommend foil taping the filter for a better seal. See Video. Foam sleeve missing at suction line creates condensation and drips water.



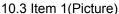



10.3 Item 2(Picture)

10.4 Presence of installed Heat Source in each room

Comments: Inspected

37 Star Lane Page 22 of 36

10.5 Chimneys, Flues and Vents (for fireplaces, gas water heaters, or heat systems)

Comments: Inspected

10.6 Solid fuel heating devices (Fireplaces, Woodstove)

Comments: Inspected

10.7 Gas/LP Firelogs and Fireplaces

Comments: Inspected

10.8 Cooling and Air Handler Equipment

Comments: Inspected

Air handler and heat pump is old but appears to be working properly. Foam sleeve on suction line is not covering copper line and condensation can drip.



10.8 Item 1(Picture)

10.9 Normal Operating Equipment

Comments: Inspected

10.10 Presence of installed Cooling Source in each room

Comments: Inspected

The heating and cooling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

37 Star Lane Page 23 of 36

11. Home Warranty Offer

Items

11.0 This home is eligible for a one year Home Warranty offer! Comments:

Items included in the one year home warranty if purchased are: Furnaces, Boilers, Heat Pumps, Central Air Conditioners, Electrical System, Thermostats, Water heater System, Plumbing, Polybutylene lines, Sump Pump, WhirlPools, Dishwasher, Food Waste Disposer, Cooking Range/Oven, Microwave, Kitchen Refrigerator, Trash Compactor, Plumbing Fixtures and Faucets, Domestic Water Softener, Clearing of Line Stoppage, Well Water System, Refrigerant Recapture and Disposal, Permits in conjunction with a covered repair, Code Violations in conjunction with a covered repair, Improper installation or modification, Removal of defective equipment, Fireplace gas burner, Attic and Exhaust fans, Humidifiers, Dehumidifiers, Electronic Air Filtering Devices, Door bell System, Lighting Fixtures, Septic Lines, Ejector pump. For more information and to compare warranties or purchase this warranty, please click on the Warranty offer beside your uploaded report.

37 Star Lane Page 24 of 36

General Summary



Home Detectives of Long Island, Inc.

1250 Wantagh Ave, Box 7828 Wantagh, NY 11793

Customer John Doe

Address 37 Star Lane New York NY

The following items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling**; or **warrants further investigation by a specialist**, or **requires subsequent observation**. This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

1. Roofing / Chimneys / Roof Structure and Attic

1.0 Roof Coverings

Repair or Replace

- (1) Evidence of a leak in the Den below corresponds with the middle skylight roof and flashing area. Repairs are needed. Recommend a qualified contractor inspect further and repair as needed.
- (2) The roof covering was installed improperly above garage. Roof sheathing needs to be replaced in this area. This will involve some shingle replacement. A qualified contractor should inspect and repair as needed.



1.0 Item 1(Picture)

1.4 Roof Drainage Systems (gutters and downspouts)

37 Star Lane Page 25 of 36

1. Roofing / Chimneys / Roof Structure and Attic

Repair or Replace

The gutter screens are missing at the front of home above garage. Gutters that drain poorly or clogged can lead to many costly problems such as deterioration of fascia, soffit or roof edge. It can also cause gutters to pull loose and lead to possible water intrusion. A qualified person should repair or replace as needed.

2. Exterior

2.0 Wall Cladding, Flashing and Trim

Repair or Replace

A The Wood siding at the right side (facing front) and rear of home is missing or incomplete at time of inspection around new premium windows that have recently been installed. I did not inspect the installation of siding at this location. A qualified contractor should inspect and repair as needed. The siding will need prep and paint.





2.0 Item 1(Picture)

2.0 Item 2(Picture)





2.0 Item 3(Picture) 2.0 Item 4(Picture)

2.4 Vegetation, Grading, Drainage, Driveways, Patio Floor, Walkways and Retaining Walls (With respect to their effect on the condition of the building)

37 Star Lane Page 26 of 36

Repair or Replace

- (1) Possible water run-off from the street into driveway during rain. I am unable to determine the frequency or amount.
- (2) The brick walkway at the front of home are deteriorated in areas. A general replacement is likely. A qualified contractor should inspect and repair as needed.





2.4 Item 1(Video) Water signs at front step

2.4 Item 2(Picture)





2.4 Item 3(Picture)

2.4 Item 4(Picture)

(4) The brick floor on the patio at the left side (facing front) has deteriorated mortar or grout, and is loose and uneven in areas. Water can cause further deterioration if not repaired and sealed properly. A qualified contractor should inspect and repair as needed.

37 Star Lane Page 27 of 36



2.4 Item 6(Picture)

(5) The brick floor on the patio at the rear of home is old and deteriorated. A general replacement is likely. A qualified contractor should inspect and repair as needed.



2.4 Item 7(Picture)

2.5 Eaves, Soffits and Fascias

Repair or Replace

(1) The wood fascia and soffit panels at eave on the front of home above garage are deteriorated. Repairs are needed to roof covering as well. A qualified contractor should inspect and repair as needed.

37 Star Lane Page 28 of 36





2.5 Item 1(Picture)

2.5 Item 2(Picture)

(2) The wood fascia at eave on the right side (facing front) is deteriorated. This is a small repair. A qualified contractor should inspect and repair as needed.



2.5 Item 3(Picture)

4. Kitchen Components and Appliances

4.5 Counters and a representative number of Cabinets Repair or Replace

A Base Cabinetry and trim at wall cabinet are unfinished at kitchen.

37 Star Lane Page 29 of 36

4. Kitchen Components and Appliances





4.5 Item 2(Picture)

4.5 Item 1(Picture)

4.9 Dishwasher


Repair or Replace

The dishwasher is loose and needs securing to underside of countertop (using a proper length screw). I recommend repair as necessary.

4.14 Microwave Cooking Equipment

Repair or Replace

The microwave door handle is broken. I recommend repair as needed.

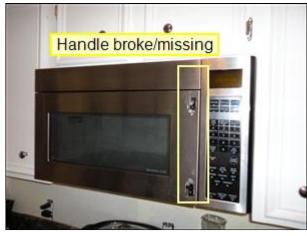

4.14 Item 1(Picture)

5. Rooms

5.0 Ceilings

Repair or Replace

(1) The Sheetrock on the ceiling reveals a water stain indicating a leak did or still exists at the Den. Repairs are needed. A qualified contractor should inspect and repair as needed (See Roof Coverings).

37 Star Lane Page 30 of 36



5.0 Item 1(Picture)

(2) Water stain on ceiling panel lower level indicates plumbing leak.



5.0 Item 2(Picture)

(3) The Drywall on the ceiling reveals a water stain indicating a leak did or still exists at the Dining Room. Repairs are needed. A qualified contractor should inspect and repair as needed.



5.0 Item 3(Picture)

5.0 Item 4(Video)

5.1 Walls

37 Star Lane Page 31 of 36

Repair or Replace

- (1) Unfinished around windows in kitchen, and Den.
- (2) The Wall at the bathtub is deteriorated and needs repair or replacement. The wall board and framing may need repair (not visible). I recommend repair or replace using a qualified contractor.



5.1 Item 1(Picture)

(3) The sheetrock on the wall is dented or damaged from door knob at the hallway. While this damage is cosmetic, it needs to be repaired. A qualified contractor should inspect and repair as needed.



5.1 Item 2(Picture)

(4) Stair cover trim is unfinished needs prep and paint at stairs.

37 Star Lane Page 32 of 36



5.1 Item 3(Picture)

5.2 Floors

Repair or Replace

Carpet is loose or cut short from where electric baseboard use to be in areas around the perimeter of the Den.



5.2 Item 1(Picture)

10. Heating / Central Air Conditioning

10.3 Distribution Systems (including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units and convectors)

Repair or Replace

The washable filter is dirty. The filter needs to be cleaned. Recommend foil taping the filter for a better seal. See Video. Foam sleeve missing at suction line creates condensation and drips water.

37 Star Lane Page 33 of 36

10. Heating / Central Air Conditioning





10.3 Item 1(Picture)

10.3 Item 2(Picture)

Home inspectors are not required to report on the following: Life expectancy of any component or system; The causes of the need for a repair; The methods, materials, and costs of corrections; The suitability of the property for any specialized use; Compliance or non-compliance with codes, ordinances, statutes, regulatory requirements or restrictions; The market value of the property or its marketability; The advisability or inadvisability of purchase of the property; Any component or system that was not observed; The presence or absence of pests such as wood damaging organisms, rodents, or insects; or Cosmetic items, underground items, or items not permanently installed. Home inspectors are not required to: Offer warranties or guarantees of any kind; Calculate the strength, adequacy, or efficiency of any system or component; Enter any area or perform any procedure that may damage the property or its components or be dangerous to the home inspector or other persons; Operate any system or component that is shut down or otherwise inoperable; Operate any system or component that does not respond to normal operating controls; Disturb insulation, move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility; Determine the presence or absence of any suspected adverse environmental condition or hazardous substance, including but not limited to mold, toxins, carcinogens, noise, contaminants in the building or in soil, water, and air; Determine the effectiveness of any system installed to control or remove suspected hazardous substances; Predict future condition, including but not limited to failure of components; Since this report is provided for the specific benefit of the customer(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

Prepared Using HomeGauge http://www.HomeGauge.com : Licensed To Rob DeSanto

37 Star Lane Page 34 of 36



INVOICE

Home Detectives of Long Island, Inc. 1250 Wantagh Ave, Box 7828 Wantagh, NY 11793 Inspected By: Rob DeSanto

Inspection Date: 3/30/2012 Report ID: 37 star lane

Customer Info:	Inspection Property:
John Doe	37 Star Lane New York NY
Customer's Real Estate Professional: Victor Tate Victor Realty	

Inspection Fee:

Service Price Amount Sub-Total

Tax \$0.00

Total Price \$0.00

Payment Method: Cash Payment Status: Paid

Note:

37 Star Lane Page 35 of 36

TO THE HOME INSPECTOR: THE FOLLOWING ARE INSTRUCTIONS ON HOW TO INCLUDE YOUR INSPECTION AGREEMENT

Free of charge:

HG Staff will set up one of our sample agreements with your information for free as a sample demonstration on format, selecting fields to auto-populate etc using one of our sample agreement forms. You can do this yourself too if you have a specific agreement you have had prepared using your own contract agreement form, or we will do it for you for an extra fee at your request.

How To Use One Of Our Sample Agreements:

- 1. At the menu line in HG software choose "Office" then "Edit Report Docs" and find one of the sample agreements you like. They are named agreement-sample1.html and so forth.
- 2.Clean up the text as necessary using the built in editor and wherever you want a word to be replaced with the name, address, invoice amount etc. simply click on the drop down menu at the top labeled "Insert Merge Field" and choose the word to be populated with real name information.
- 3. Save As. Use the button with a disk on it and the "+" on it to save it as "disclaim.html". Now you are ready to use the online click agreement and it will also insert a copy of your agreement in the report.

How To Add Your Own Agreement:

- 1. At the menu line in HG software choose "Office" then "Edit Report Docs" and choose the Disclaim File:
- 2. Clear out this content and paste in yours. Note: if pasting from MS Word you must paste it first in MS notepad (Start /All Programs: Accessories: notepad), then copy from note pad and paste it here.
- 3. Next, clean up the text as necessary from the paste in, and wherever you want a word to be replaced with the name, address, invoice amount etc. simply click on the drop down menu at the top labeled "Insert Merge Field" and choose the word to be populated with real name information.
- 4. Save. Now you are ready use the online click agreement and it will also insert a copy of your agreement in the report.

Fees: Inspectors who need help using their own agreement can ask us for a fee to help them format and place in correctly. Fee is based on number of pages and if there are tables, drawings etc and how much work is involved. A simple contract with a few pages can be done easily following the instructions above, or watch a video tour at our support page on our website.

Disclaimer: The sample agreements we offer are samples. They have been used and are being used by inspectors but at your own risk. We strongly advise an attorney to review and make edits as necessary. By using any of our sample agreements you hold harmless HomeGauge and SHGI Corp and its owners. There, our disclaimer is over.

37 Star Lane Page 36 of 36